

Date: February 12, 2010

Number: TAB-10-001

To: Global Distribution

**Notice: DLS 2002 showing wrong date  
in event buffer on PowerSeries v3.2x panels**

Please note that when using DLS2002 to display and print, event buffers will show the year of the event incorrectly on PowerSeries v3.2x panels. A list of specific panels is shown below. The issue is related a numerical conversion from HEX to decimal. As a result, events in the year 2010 will display year 2016.

A patch is available through the 'Check for Web Update' utility within DLS2002 or from the Downloading Software page at [www.dsc.com](http://www.dsc.com).

Once the fix is installed, any saved event buffers with events from 2010 will still retain the incorrect year. To correct this, the event buffer will need to be uploaded and saved over the existing event buffer. Please note that if new events are appended to an event buffer that contains the incorrect year, the older 2010 events will still show the incorrect year but the order of the old and new events will still be displayed in the correct order.

Affected panels showing wrong date in DLS2002:

PC1555 v3.2  
PC5005 v3.2  
PC5010 v3.2  
PC5015 v3.2C  
PC5015 v3.2CY  
PC5019 v3.2  
PC5020 v3.2  
PC5020 v3.2A  
PC5020 v3.2C  
PC5020 v3.2CY  
PC5020 v3.2NA

**Panels, Keypads & Modules**

For more information on this product or other DSC products, email [info@dsc.com](mailto:info@dsc.com)  
or contact your local Sales Representative or Technical Support.